

Work Order ID 86679

86679

Page 1

July-06-12 11:23:07 AM

Item ID: D212-664-107TRN

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Turning Detail

Start Date: 7/06/12

Start Qty: 1.00

1

Cust Item ID:

Required Date: 7/06/12

Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: *H*

Date: *12-07-6*

Tooling:

Date:

Run Start *NR1*

QC:

Date:

SPC (Y/N):

Date:

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D212-664-147	Rev B(DE0)								

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA705

2-Turn first side as per Folio FA113

3-Blend transition lines only, **do not sand whole tube**:

FOLIO REV: *2A*

DWG REV: *B*

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

man.l
12/11/07

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Memo

0.00

Quality Control

man.l
12/11/07

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 86679

86679

Page 2

July-06-12 11:23:07 AM

Item ID: D212-664-107TRN Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Crosstube Turning Detail
 Start Date: 7/06/12 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 7/06/12 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	MORI SEIKI CNC LATHE LARGE	0.00				1	0		
120									
Mori Seiki	Memo	0.00							
Mori Seiki CNC Lathe Large	1-Turn second side as per Folio FA705								
	2-Blend transition lines only, **do not sand whole tube**: *Use mill bastard file, brush file repeatedly with file card. *Do not use sandpaper coarser than 320 grit. FOLIO REV: <u>40</u> DWG REV: <u>3</u>								
	3- Remove plugs and sand								
130	QC1- Inspect dimensions to dimension sheet	0.00				1	0		
130									
QC	Memo	0.00							
Quality Control									

maril
12/11/08

maril
12/11/08

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 86679

86679

Page 3

July-06-12 11:23:07 AM

Item ID: D212-664-107TRN

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Turning Detail

Start Date: 7/06/12 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 7/06/12 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC8- Inspect parts - second check	0.00							
140									
QC	Memo	0.00							
Quality Control									
145		0.00							
145									
Crosstubes	Memo	0.00							
Crosstubes	GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.								
150		0.00							
150									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	1- PRESSURE WASH X-TUBE INSIDE AND OUT								
	2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE								

JW 12-11-8

RM 12-11-12

MO 12/11/14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 86679

86679

Page 4

July-06-12 11:23:07 AM

Item ID: D212-664-107TRN Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Crosstube Turning Detail
 Start Date: 7/06/12 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 7/06/12 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	QC5- Inspect part completeness to step on W/O	0.00							
160									
QC	Memo	0.00							
Quality Control									
170		0.00							
170	Packaging								
Packaging	Memo	0.00							
Packaging	Identify and stock in kanban rack Location: <u>LG</u>								
180	QC21- Final Inspection - Work Order Release	0.00							
180									
QC	Memo	0.00							
Quality Control									

DAS 03 12-11-14

MO 12/11/14

12/11/15

12-11-15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

July-06-12 11:23:06 AM

Page 1

Work Order ID: 86679

Parent Item: D212-664-107TRN

Start Date: 7/06/12

Required Date: 7/06/12

Parent Item Name: Crosstube Turning Detail

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A New Issue 08-03-06 DD Verified by:ec
IPP Rev B Removed polish 08.04.02 EC verified: DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6019-128 Crosstube Material		Manufactured	No			110	Each	48.0000	1	1			

Location

Loc Qty

Loc Code

LG

48

69803

17

75635

24

79741

7

1 man. L 12/11/06

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order:	86679
Description: Crosstube Assembly (205/212/412 Low Fwd)	Part Number:	D212-664-147
Inspection Dwg: D212-664-147 Rev: B		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.313	+/-0.010	.313	✓		vern	CWC-08
	2.360	+0.005/-0.000	2.362	✓		↓	
	2.360	+0.005/-0.000	2.364	✓			
	2.366	+0.005/-0.000	2.367	✓			
	2.473	+0.005/-0.000	2.477	✓			
	2.573	+0.005/-0.000	2.578	✓			
	2.673	+0.005/-0.000	2.678	✓			
	2.750	+0.005/-0.000	2.750	✓			
	2.750	+0.005/-0.000	2.750	✓			
SIDE B	0.313	+/-0.010	.313	✓		vern	CWC-08
	2.360	+0.005/-0.000	2.363	✓		↓	
	2.360	+0.005/-0.000	2.365	✓			
	2.366	+0.005/-0.000	2.367	✓			
	2.473	+0.005/-0.000	2.478	✓			
	2.573	+0.005/-0.000	2.577	✓			
	2.673	+0.005/-0.000	2.678	✓			
	2.750	+0.005/-0.000	2.750	✓			
	2.750	+0.005/-0.000	2.750	✓			
	0.126.528	+/-0.020	126.540	✓		tape	LG-22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order:	86679
Description: Crosstube Assembly (205/212/412 Low Fwd)	Part Number:	D212-664-147
Inspection Dwg: D212-664-147 Rev: B		Page 2 of 2

WALL THICKNESS MEASUREMENT

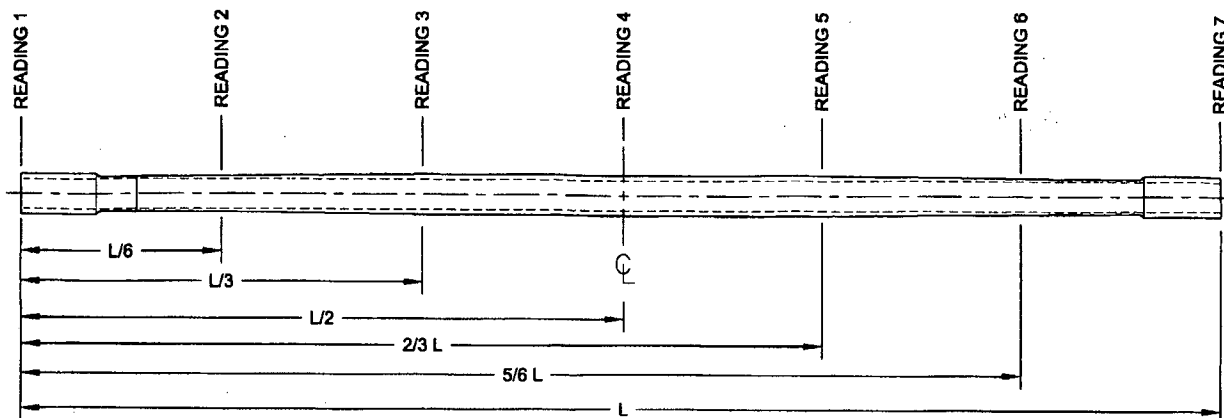

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.126	.117	.137	.140	.023	0.048"
READING 2 L= 14	.124	.111	.138	.157	.041	
READING 3 L= 30	.220	.207	.227	.245	.038	
READING 4 L= 63	.320	.326	.329	.335	.015	
READING 5 L= 30	.232	.225	.218	.227	.014	
READING 6 L= 14	.133	.122	.128	.141	.019	
READING 7 L= cut off	.125	.129	.132	.135	.010	

Calibration Result

Actual Block Thickness: .100 .500

Sitescan 250 Measured Thickness: .100 .500

Measured by:	man.c
Date:	12/11/08

Audited by:	JW
Date:	12-11-8

Prototype Approval:	N/A
Date:	N/A

Rev	Date	Change	Revised by	Approved
A	08.11.07	New Issue (P/O D212-664-107)	KJ/EC	
B	10.02.02	Dimension 126.528 was 126.53	KJ	
C	12.06.04	Wall thickness form added	KJ	

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	Qty -147	Qty -147B	Part Number	Description
1	X		D212-664-147	CROSSTUBE ASSEMBLY (205/212/412 LOW FWD)
2		X	D212-664-147B	CROSSTUBE ASSEMBLY (214 LOW FWD)
3	1	1	D6019-128	CROSSTUBE
4	2	2	D2893-1	SUPPORT
5	4	4	D3595-063-450	RUBBER CUSHION
6	2	2	D3659-1	CUFF
7	4	4	MS21920-25	CLAMP (OR MS21920-26)
8	44	44	CR3212-4-06	RIVET (OR M7885/3-4-06)
9	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
10	A/R	A/R	SIKAFLEX-241/-291	SEALANT (OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6019-128
FINISHED LENGTH = 126.528±0.020 (BEFORE BENDING/TRIMMING)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF
USING VIBRATING STYLUS.
- 7) WEIGHT: D212-664-147 = 24.2 lbs (PER LIN-D212-664)
D212-664-147B = 24.2 lbs (PER LIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) WHEN MACHINING TAPER, RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD
BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6%
BASED ON O.D., EXCEPT UP TO 10% IS ALLOWED IN AREA NOTED.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF
D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER
INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE
SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS.
DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE
UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS
NOT BOTTOMED-OUT AFTER TORQUING.
- 16) INSTALL D3659-1 CUFF AFTER CHEMICAL CONVERSION COAT BUT BEFORE PAINT, WITH A LAYER OF
SIKAFLEX-241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT BETWEEN CUFF AND CROSSTUBE.
SEAL EDGE OF CUFF TO ENSURE NO GAPS.
- 17) TOUCH-UP HOLES WITH CHEMICAL CONVERSION COAT.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 86629
12076

DEO ATTACHED

Per ECW#1164
110720
UNDER REVIEW
11/08/13

RELEASED
2009-10-29
JW

B	REVISE GENERAL NOTES/PART LIST; UPDATE TO CURRENT STANDARDS; ADD -147B (ZN C4-2, D4-2)	RF	09.09.30
A	NEW ISSUE	CP	07.07.07
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF	DRAWING NO.	REV. B
CHECKED	RF	D212-664-147	SHEET 1 OF 4
MFG. APPR.	RF	TITLE	SCALE
APPROVED	RF	CROSSTUBE (205/212/412 LOW FWD)	NTS
DE APPR.	RF	DATE 09.09.30	
COPYRIGHT © 2007 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

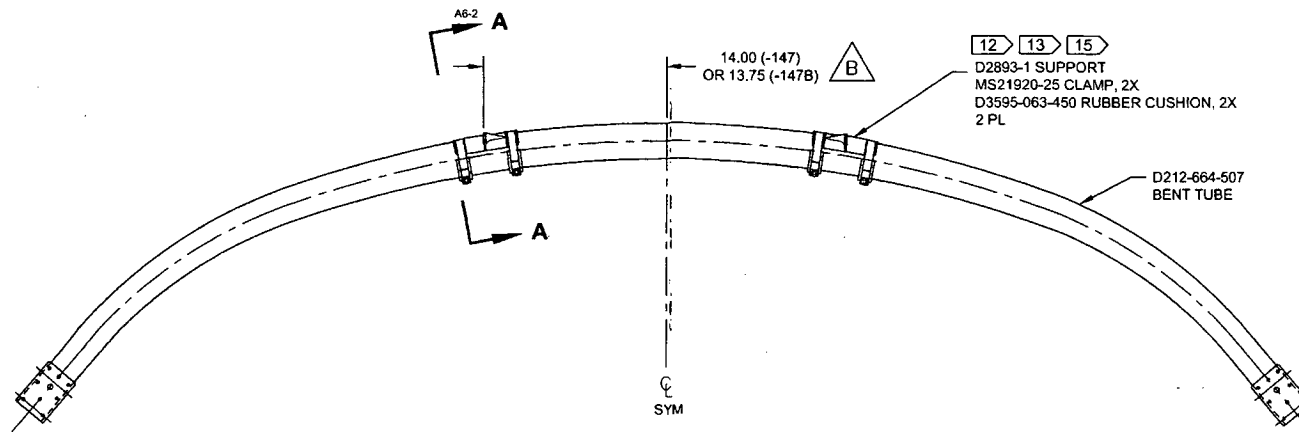

**D212-664-147/-147B
ASSEMBLY DETAIL**

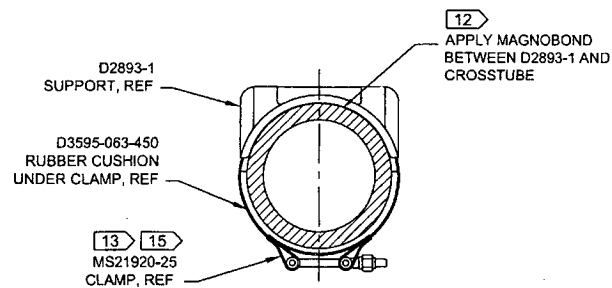

SECTION A-A D5-2
SCALE 4X

DEO ATTACHED

ECW #11-614
28.09.20
UNDER REVIEW
CP 11.8.13

RELEASED
2009-10-29

DESIGN	9P	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	9P	DRAWING NO.	REV. B
MFG. APPR.	18	D212-664-147	SHEET 2 OF 4
APPROVED	18	TITLE	SCALE
DE APPR.	18	CROSSTUBE (205/212/412 LOW FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2007 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

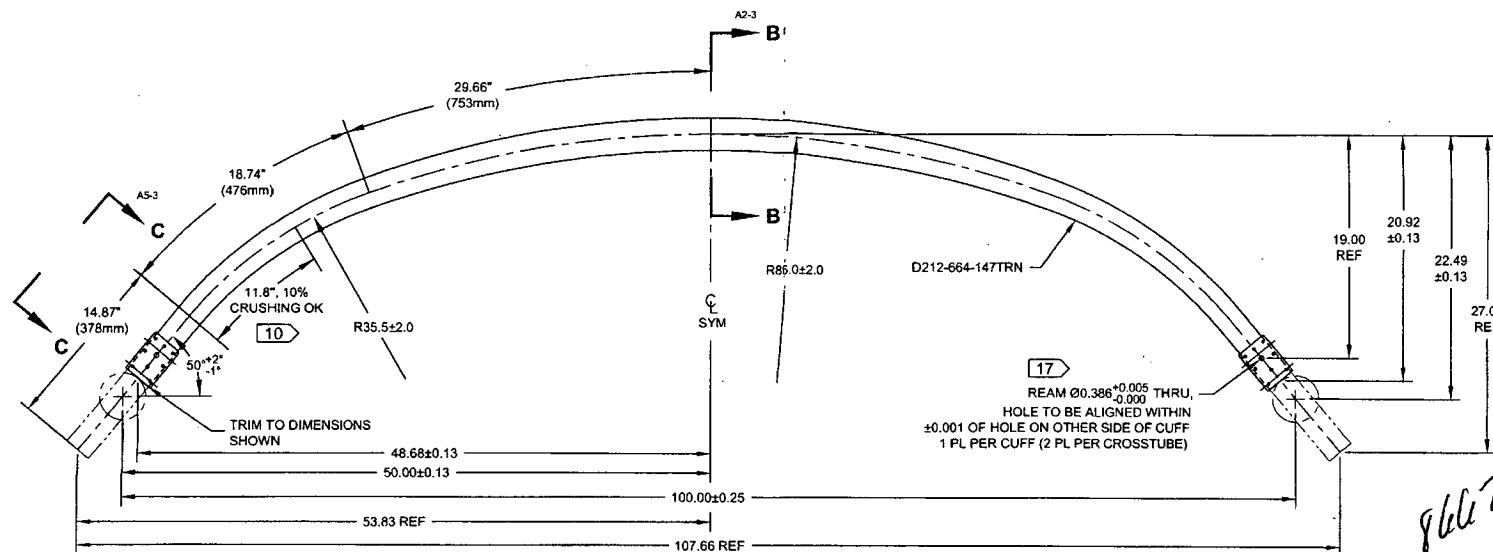

D212-664-507
BENDING AND DRILLING DETAIL 10 B

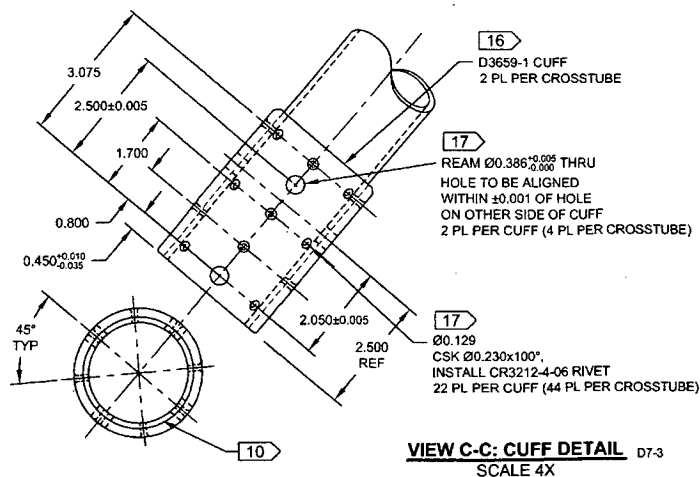

VIEW C-C: CUFF DETAIL D7-3
 SCALE 4X

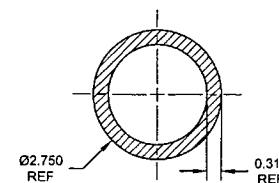

SECTION B-B D5-3
 SCALE 4X

60411-614
 09.09.20
UNDER REVIEW
 09.04.13

RELEASED
 2009-10-29

DESIGN	9	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	9	DRAWING NO.	REV. B
MFG. APPR.	18	D212-664-147	SHEET 3 OF 4
APPROVED	19	TITLE	SCALE
DE APPR.	19	CROSSTUBE (205/212/412 LOW FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2007 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DESIGN	RF	DATE	09.09.30
DRAWN	RF	DE APPR.	
CHECKED	RF	APPROVED	
DRAWING NO.	D212-664-147	MFG. APPR.	
REV. B		TITLE	CROSS TUBE (205/212/412 LOW FWD)
SHEET 4 OF 4		SCALE	NTS
DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA			

RELEASED
2009-10-29


UNDER REVIEW
11.07.26

DEO ATTACHED

EC0 #1-614
11.06.13

84479

D212-664-147TRN
TURNING DETAIL

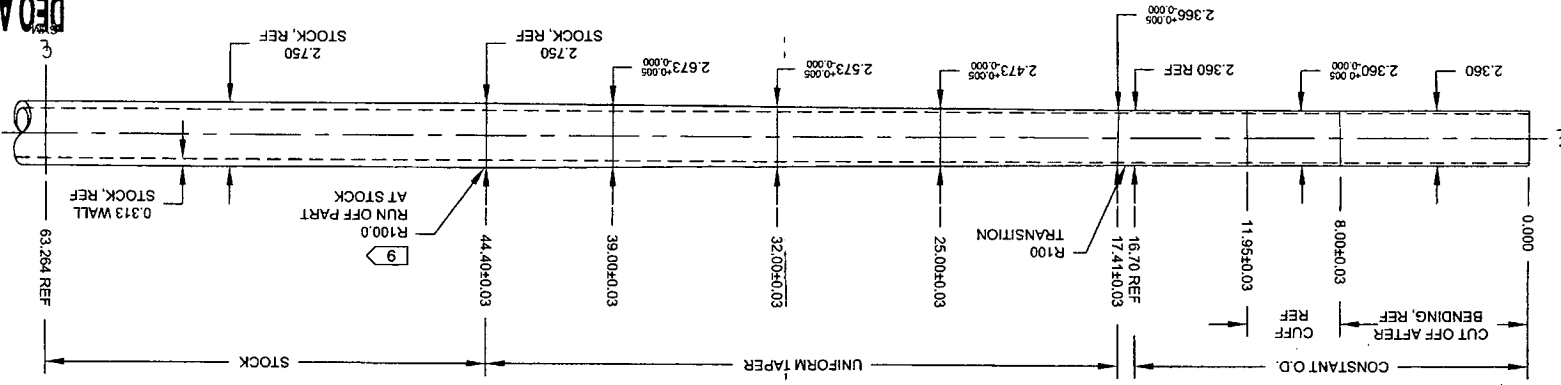

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D212-664-147	TITLE CROSSTUBE ASS'Y (205 LOW FWD)	REV. B	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-147-B-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>q</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>VB</i>	APPROVED <i>WJ</i>		DE APPR. <i>WJ</i>		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/07/21		DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -147	Qty -147B	Part Number	Description
9	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

9	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2893-1 SUPPORT: ABRABE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

86679

RELEASED
2011-07-28
WJ

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries